



**Technical Service
Information Bulletin**

July 10, 2007

Title:

**TRUNK WILL NOT OPEN WHEN USING
REMOTE OR INTERIOR SWITCH**

Models:

'07 LS 460

ELECTRICAL
EL012-07

Introduction Customers may complain that the trunk is stuck closed and will not open when using the remote or interior switch. The trunk can continue to be opened using the key or interior safety pull. A new luggage room Junction Block has been developed to correct this condition. Use the following repair procedure to replace the luggage room Junction Block.

- Applicable Vehicles**
- **2007** model year **LS 460** vehicles **NOT** equipped with the power closer trunk and produced **BEFORE** the Production Change Effective VIN shown below.

**Production
Change
Information**

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
LS 460	JTHBL46F#75024448

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
82670-50110	82670-50120	Luggage Room Junction Block	1

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EL7010	R & R Luggage Room Junction Block	0.5	82670-50110	72	74

Applicable Warranty*:

This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




Repair Procedure

1. Record radio presets.
2. Gain access to the trunk by using the mechanical key. Turn the mechanical key clockwise to open.

**NOTE:**

For vehicles equipped with the Lexus Navigation System, ensure that the vehicle has been OFF for at least 2 minutes BEFORE disconnecting the battery.

3. Disconnect the battery.
4. Remove the LH luggage room trim panel.
5. Replace the luggage room Junction Block.

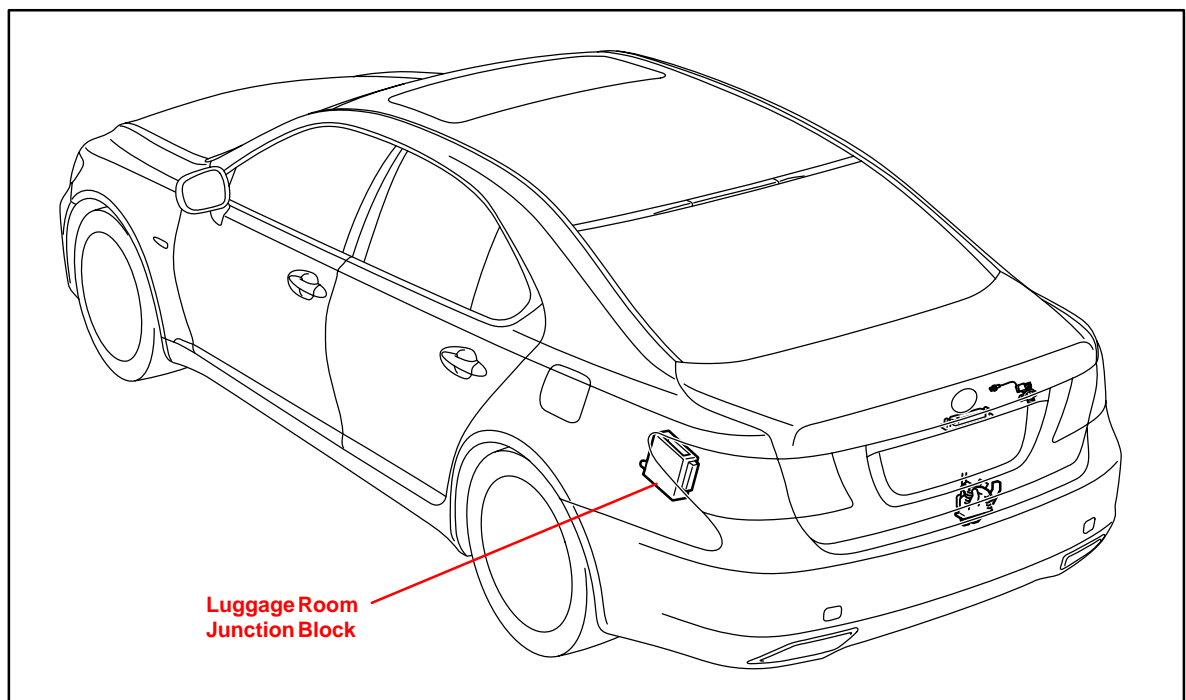

6. Install the LH luggage room trim panel.
7. Reconnect the battery.

**Repair
Procedure**
(Continued)

8. Test for proper operation of the rear trunk.
9. Re-initialize any affected power systems.
Refer to TSIB No. PD007-07, "*Power System Initialization During PDS*".
10. Reset radio presets.